XBA-USD6 Option Switch Settings

Supported bill $ 1, 5, 10, 20, 50, 100 6bills.

FUNCTION	SW1	SW2	SW3	SW4	SW5	SW6	SW7	SW8
Reject $ 1	ON							
★ Accept $ 1	OFF							
Reject $ 5		ON						
★ Accept $ 5		OFF						
Reject $ 10			ON					
★ Accept $ 10			OFF					
Reject $ 20				ON				
★ Accept $ 20				OFF				
Reject $ 50 、 100					ON			
★ Accept $ 50 、 100					OFF			
Disable Bill Reject 4 Times BA Stop By 30 Sec						ON		
★ Enable Bill Reject 4 Times BA Stop By 30 Sec						OFF		
Stack Banknote when Power-up							ON	
★ Reject Banknote when Power-up							OFF	
ENABLE IrDA Download								ON
★ Reserved								OFF

This dip switch is located at the side of XBA.

(2)

LED

DIP Switch
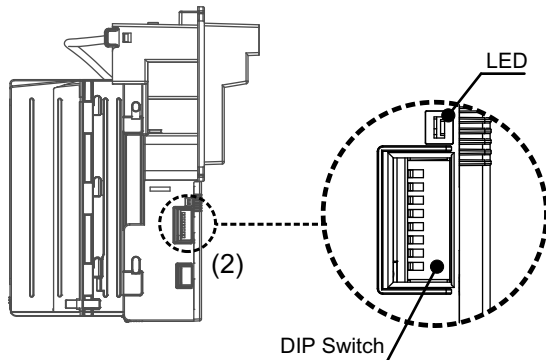
Currency Assign Data

Interface / Bill value	ICT002U	ICT104U	ICT104V	Pulse	MDB
BV1	$ 1	$ 1	$ 1	$ 1	$ 1
BV2	$ 5	$ 5	$ 5	$ 5	
BV3	$ 10	$ 10	$ 10	$ 10	$ 5
BV4	$ 20	$ 20	$ 20	$ 20	$ 10
BV5	$ 50	$ 50	$ 50	$ 50	$ 20
BV6	$ 100	$ 100	$ 100	$ 100	$ 50
BV7					$ 100

Appendix

XBA-USD6 (Pulse/MDB/ICT)

FUNCTION	SW1	SW2	SW3	SW4	SW5	SW6	SW7	SW8
Inhibit Active HIGH	ON							
★ Inhibit Active LOW	OFF							
ENABLE INHIBIT-Sleep only		ON						
★ 5 second Timeout only		OFF						
Normal (Note.2)			OFF	OFF				
Mode 1 (Note.3)			OFF	ON				
Mode 2 (Note.4)			ON	OFF				
★ Mode 1 + 2 (Note.5)			ON	ON				
★ Credit-Pulse Normal HIGH					ON			
Credit-Pulse Normal LOW					OFF			
★ Pulse Mode						ON		
Other Mode						OFF		

Pulse Mode	Other Mode		SW7	SW8
★ 1 pulse / $ 1	MDB Mode		OFF	OFF
2 pulse / $ 1	ICT002U Mode		OFF	ON
4 pulse / $ 1	ICT104U Mode		ON	OFF
20 pulse / $ 1	ICT104V Mode		ON	ON

This dip switch is located on the CPU board, remove the CPU board cover first.

(1)
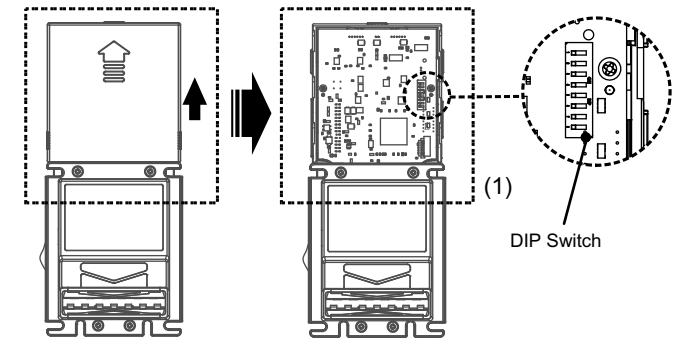
DIP Switch

★ Manufacture setting

Note：1. Affer setting dip switch of the credit pulses, you should reset the bill acceptor again.

2. Normal ：No sleep function.

3. Mode 1 ：Bill-acceptor wakes up VMC with banknote only (special cable required).

4. Mode 2 ：VMC wakes up bill-acceptor.

5. Mode 1+2 ：Bill-acceptor wakes up with banknote or by VMC.