


XBA-SGD4 Option Switch Settings

Supported bill \$ 2, 5, 10, 50 4bills.

FUNCTION	SW1	SW2	SW3	SW4	SW5	SW6	SW7	SW8
★ Reject \$ 2	ON							
★ Accept \$ 2	OFF							
★ Reject \$ 5		ON						
★ Accept \$ 5		OFF						
★ Reject \$ 10			ON					
★ Accept \$ 10			OFF					
★ Reject \$ 50				ON				
★ Accept \$ 50				OFF				
Reserved					ON			
Reserved					OFF			
★ Disable Bill Reject 4 Times BA Stop By 30 Sec						ON		
★ Enable Bill Reject 4 Times BA Stop By 30 Sec						OFF		
★ Stack Banknote when Power-up							ON	
★ Reject Banknote when Power-up							OFF	
★ ENABLE IrDA Download								ON
★ Reserved								OFF

This dip switch is located at the side of XBA.

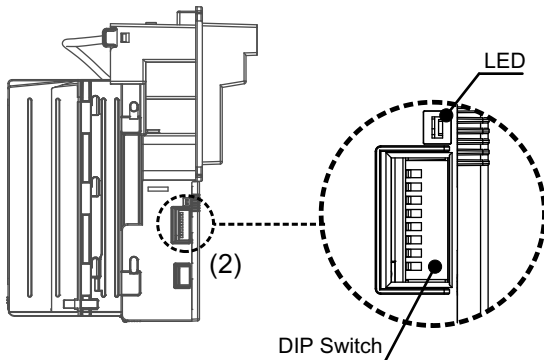


Currency Assign Data

Interface Bill value	ICT002U	ICT104U	ICT104V	Pulse	MDB
BV1	\$ 2	\$ 2	\$ 2	\$ 2	\$ 2
BV2	\$ 5	\$ 5	\$ 5	\$ 5	\$ 5
BV3	\$ 10	\$ 10	\$ 10	\$ 10	\$ 10
BV4	\$ 50	\$ 50	\$ 50	\$ 50	\$ 50

XBA-SGD4 (Pulse/MDB/ICT)

FUNCTION	SW1	SW2	SW3	SW4	SW5	SW6	SW7	SW8
Inhibit Active HIGH	ON							
★ Inhibit Active LOW	OFF							
★ ENABLE INHIBIT-Sleep only		ON						
★ 5 second Timeout only		OFF						
★ Normal (Note.2)			OFF	OFF				
★ Mode 1 (Note.3)			OFF	ON				
★ Mode 2 (Note.4)			ON	OFF				
★ Mode 1 + 2 (Note.5)			ON	ON				
★ Credit-Pulse Normal HIGH					ON			
★ Credit-Pulse Normal LOW					OFF			
★ Pulse Mode						ON		
★ Other Mode						OFF		
Pulse Mode						Other Mode		
★ 1 pulse / \$ 1						MDB Mode	OFF	OFF
★ 5 pulse / \$ 1						ICT002U Mode	OFF	ON
★ 10 pulse / \$ 1						ICT104U Mode	ON	OFF
★ 25 pulse / \$ 1						ICT104V Mode	ON	ON

This dip switch is located on the CPU board, remove the CPU board cover first.

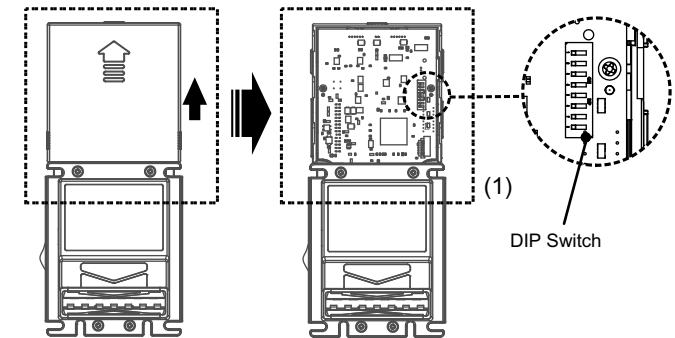

★ Manufacture setting

- Note :
1. After setting dip switch of the credit pulses, you should reset the bill acceptor again.
 2. Normal : No sleep function.
 3. Mode 1 : Bill-acceptor wakes up VMC with banknote only (special cable required).
 4. Mode 2 : VMC wakes up bill-acceptor.
 5. Mode 1+2 : Bill-acceptor wakes up with banknote or by VMC.
 6. BV1=\$ 2, BV2=\$ 5, BV3=\$ 10, BV4=\$ 50.